Intelligent Sensing Framework 2.1 for Kinetis Errata Sheet

The following errata sheet covers changes to the Freescale Intelligent Sensing Framework 2.1 (ISF 2.1) middleware, released for Kinetis[®] platforms. ISF 2.1 consists of Processor Expert[®] components that can be updated independent of a release.

These changes are made to the ISF R2P1 PEx.PEupd file (REV 1) that is added to the ISF project via CodeWarrior[®] or Kinetis Design Studio (KDS).

These changes have been tested locally but a complete regression test on the various platforms has not been conducted. However, it is the best interest of users to include these updates in a timely fashion.

Revision History

Rev	Date	Description	
0	3/2015	Open and closed defects; defect corrections associated with the initial interim update to the ISF R2P1 PEx.PEupd file (REV 1).	

Contents

1	ISF Known Defects and Limitations	. 2
	1.1 Software Limitation	. 2
	1.2 Open Defects	
	1.3 Closed Defects	
	ISF Errata Change Log	



1 ISF Known Defects and Limitations

Defect priority level is classified as follows:

Priority	Description	
L1	The defect causes the system to fail. There is no known workaround.	
L2	The defect fails to meet key functional requirements. There is a workaround.	
L3	The defect or enhancement should be fixed in the next scheduled release.	
L4	The defect or enhancement is noncritical.	
L5	The defect or enhancement is trivial or cosmetic.	

1.1 Software Limitation

Each embedded application is limited to accessing each specific sensor in a single subscription.

1.2 Open Defects

Defect ID	Ticket Summary	Ticket Submission Date	Priority
CR340211	ISF 2.0 depends upon an update to the MQXLite_task PEx component in order to compile properly. Users must use the most recent version of CodeWarrior 10.6.1.	order to compile properly. Users must use 18 November 2014	
CR3402141	ISF Sensor Adapter PEx Components sometimes fail to offer I2C_CH1 Communications Channel to User.	18 November 2014	L3
CR340662 ²	1 In order for the Command Interpreter (CI) Streaming feature to work properly, the user must manually type in the following into the Protocol component methods: ci_stream_init ci_protocol_CB_stream		L3
SSDSBOX-30 ³	SDSBOX-30 ³ Some internal tasks using floating point calculations do not enable MQX_FLOATING_POINT_TASK properly.		L3
SSDSBOX-494	SDSBOX-49 ⁴ There are numerous typographical errors in the generic sensor type definitions.		L5
SSDSW-3 There are remnants of the MAG3110 embedded ap appearing in the code generated in App1.c		18 March 2015	L5
SSDSW-9	The fixed point conversion factors in FXOS8700CQ and FXAS21002C sensor adapters are incorrect. The fixed-point acceleration data has 15 fraction bits rather than 16. It is suspected that similar situation exists for the magnetometer and gyroscope data as well.	18 March 2015	L3

Table 1. Open defects

Defect ID	Ticket Summary	Ticket Submission Date	Priority
SSDSW-79	Orientation Sensor does not include pressure data, the 10 th axis	16 March 2015	L2
1. Also known as SSDSW-10			

2. Also known as SSDSW-6

3. Also known as SSDSW-4

4. Also known as SSDSW-8

1.3 Closed Defects

Table 2. Closed defects – ISF 2.1 PEupd.PE (Rev 1) (20 March 2015)

Defect ID	Ticket Summary	Ticket Closure Date	Priority
SSDSW-2	FXAS21002 Sensor Adapter reports incorrect response to WHOAMI command.	20 March 2015	L2
SSDSW-64	The floating point conversion factors in MPL3115 sensor adapter are incorrect.	sor 20 March 2015	
SSDSW-98	SSDSW-98 The stack size for MainTask of ISFEmbApp cannot be 20 March 20 modified.		L3

Table 3. Closed defects - ISF 2.1 (6 March 2015)

Defect ID	Ticket Summary	Ticket Closure Date	Priority
CR3402071	The installation shows unit test information released in the core library. 6 March 2015		L3
CR345614	The CI mailbox protocol does not use 2 bytes for offset as specified in the SWRM.	30 January 2015	L3
CR345907	If the Component name for the ISFEmbApp component is changed, the compilation fails.		L3
CR345910	The FXOS8700CQ sensor adapter does not properly support accelerometer only usage at frequencies other than 400 Hz.30 January 2015		L3
CR346036	The Device ID Command does not consistently return the expected 18 bytes of data. 30 January 2015		L2
SSDSBOX-81	SDSBOX-81 Timestamp resolution has only 5 µsec resolution by default and may create duplicate timestamps. 9 February 2015		L3

1. Also known as SSDSW-5

Document Number: ISF2P1_KINETIS_ER Revision 0, 3/2015



Defect ID	Ticket Summary	Ticket Closure Date	Priority
CR312443	The Device info command returns incorrect values for legacy data fields.	s incorrect values for 30 September 2014	
CR318202	CW 10.6 build fails due to code duplication.	28 September 2014	L5
CR325403	Incomplete Error Handling in the DSA.	1 December 2014	L2
CR339505	Bus Manager appears to run out of tokens in the Newton sensor adapter.	ears to run out of tokens in the Newton 1 December 2014	
CR340065	When the host writes an incorrect sample period data to the MAG310, the incorrect value is saved in memory even though an error message is sent to the user.	in memory even 8 December 2014	
CR340212	Remove compilation warnings (Warnings generated by MQX [™] remain.)		
CR340215	Improve the error handling in the Embedded Application goto-state.	25 November 2014	L3
CR340217	CR340217 Lack of error handling in Sensor Adapters. 25 November 2		L3

Table 4. ISF 2.0 Release (December 2014)

2 ISF Errata Change Log

These changes have been tested locally but a complete regression test on the various platforms to the ISF R2P1 PEx.PEupd file (REV 1) has not been conducted. However, it is the best interest of users to include these updates in a timely fashion.

Beginning with Version 2.1 (March 2015), ISF for Kinetis software errata are published in this errata sheet. Errata for earlier ISF for Kinetis releases were published in the software release notes. The following table chronicles the releases of these documents .

ISF Release	Description	Document	
Version 2.1 (March 2015)	Updated ISF R2P1 PEx.PEupd file (REV 1)	Errata Sheet (This document)	
Version 2.1 (March 2015)	Sensor Fusion incorporated as a virtual Orientation sensor.	Release Notes (ISF2P1_KINETIS_RN)	
Version 2.0 (December 2014)	ISF integrated with Processor Expert with hardware abstraction for entire Kinetis platforms supporting PIT timers.	Release Notes	
Version 1.1 (April 2014)	This the initial ISF release supporting Kinetis KL25Z.	Release Notes	

Table 5. ISF Errata Changes

How to Reach Us: Home Page: freescale.com

Web Support: freescale.com/support Information in this document is provided solely to enable system and software implementers to use Freescale products. There are no express or implied copyright licenses granted hereunder to design or fabricate any integrated circuits based on the information in this document. Freescale reserves the right to make changes without further notice to any products herein.

Freescale makes no warranty, representation, or guarantee regarding the suitability of its products for any particular purpose, nor does Freescale assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters that may be provided in Freescale data sheets and/or specifications can and do vary in different applications, and actual performance may vary over time. All operating parameters, including "typicals," must be validated for each customer application by customer's technical experts. Freescale does not convey any license under its patent rights nor the rights of others. Freescale sells products pursuant to standard terms and conditions of sale, which can be found at the following address: freescale.com/SalesTermsandConditions.

Freescale and the Freescale logo, Kinetis, CodeWarrior and Process Expert are trademarks of Freescale Semiconductor, Inc., Reg. U.S. Pat. & Tm. Off. All other product or service names are the property of their respective owners.

© 2015 Freescale Semiconductor, Inc.

Document Number: ISF2P1_KINETIS_ER Revision 0, 3/2015

